SKYES-NINE DEPARTURE (SKYES 9•SKYES)

RIVERSIDE, CALIFORNIA

SHL-348 [USAF]

Rwy	Knots	60	120	180	240	300	360
32	V/V(fpm)	280	560	840	1120	1400	1680

Minimum Climb Rate to PDZ
R-130/25 DME or passing 6000.

ATIS★134.75 239.05
GND CON/CLNC DEL
121.75 335.8
TOWER★
127.65 253.5
SOCAL DEP CON
134.0 278.3
MARCH RADAR
133.5 324.1
LOS ANGELES CENTER
132.5 284.7

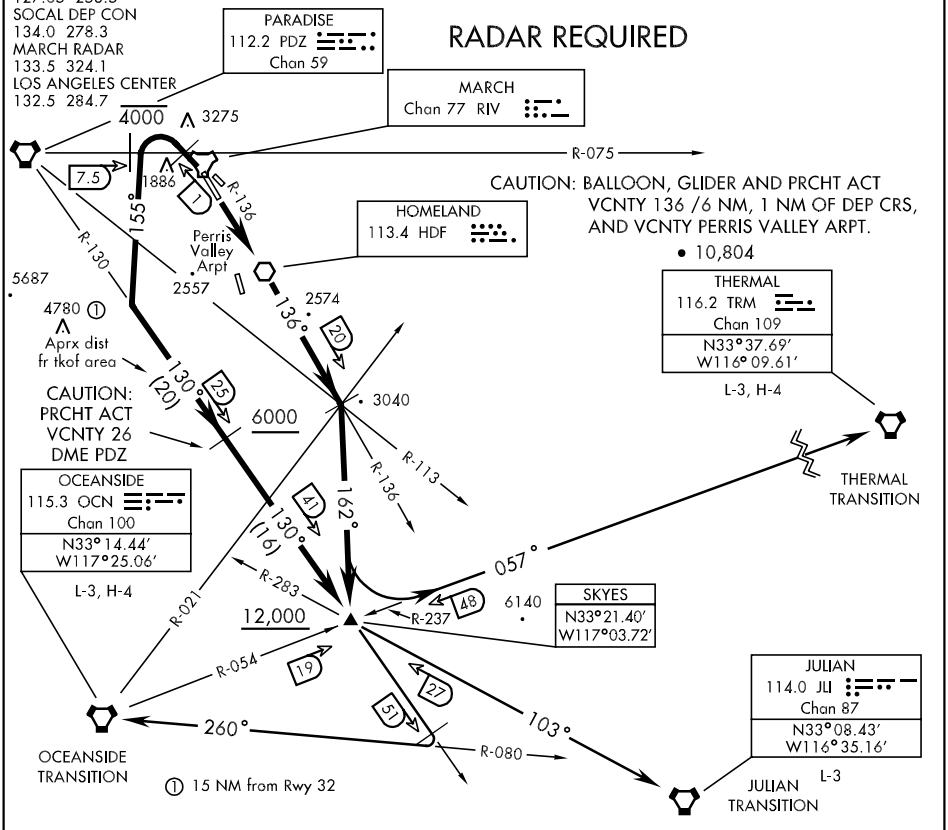

DEPARTURE ROUTE DESCRIPTION

TAKE-OFF RWY 14: Climb direct HDF then via R-136 to PDZ R-113 or climb via RIV R-136 to 20 DME. Then turn right track/heading 162° direct SKYES. Cross SKYES at or above 12,000. Thence via transition or assigned route.

TAKE-OFF RWY 32: Climb on track/heading 315°, turn left crossing PDZ R-075/RIV 1 DME to track/heading 155°, cross PDZ R-075 southbound at or below 4000′. Proceed no closer than 7.5 DME PDZ. Remain within 5 DME RIV. Intercept PDZ R-130 to SKYES, cross PDZ R-130/25 DME at or above 6000′, SKYES at or above 12,000. Thence via transition or assigned route.

JULIAN TRANSITION (SKYES 9•JLI): JLI R-283 JLI.

OCEANSIDE TRANSITION (SKYES 9•OCN): Via SKYES and PDZ R-130/51 DME intercept OCN R-080 to OCN.

THERMAL TRANSITION (SKYES 9•TRM): TRM R-237 to TRM.

SW-3, 23 NOV 2006 to 21 DEC 2006
SW-3, 23 NOV 2006 to 21 DEC 2006